
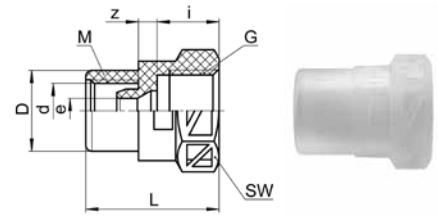


Übergangsmuffe Adaptateur femelle Female adaptor

SO 20030


Type -d -G	Mat.-Nr.	bar +	M	SW	L	D	i	z	e	kg/100
G=Rohrgewinde (zylindrisch)	G=Filetage-gaz BSP (cylindrique)		G=BSP thread (parallel)							
SO 20030-6-1/8	126.0301.100	10	10x1.0	14	20.5	13.0	9.0	3.0	4.0	3.010
SO 20030-6-1/4	126.0301.110	10	10x1.0	17	21.5	13.0	10.0	3.0	4.0	4.210
SO 20030-8-1/4	126.0301.170	10	12x1.0	17	23.0	15.0	10.0	3.0	6.0	4.680
SO 20030-10-1/4	126.0301.270	10	14x1.0	17	23.5	18.0	10.0	3.0	8.0	5.510
SO 20030-10-3/8	126.0301.280	10	14x1.0	22	24.5	18.0	11.0	3.0	8.0	7.730
SO 20030-12-3/8	126.0301.390	10	16x1.0	22	25.5	20.5	11.0	3.0	10.0	8.920
SO 20030-12-1/2	126.0301.400	10	16x1.0	27	29.0	21.0	14.0	3.5	10.0	14.180
SO 20030-16-3/8	126.0301.564	10	22x1.5	22	34.0	26.0	11.0	6.0	13.0	14.150
SO 20030-16-1/2	126.0301.566	10	22x1.5	27	37.5	26.0	14.0	6.5	13.0	18.850
SO 20030-16-3/4	126.0301.568	10	22x1.5	32	39.0	26.0	15.0	7.0	13.0	21.540

Anwendungsbeispiele:

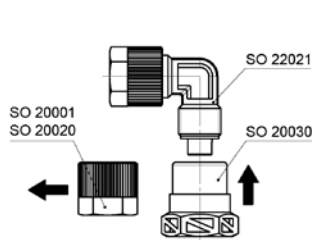


Die Übergangsmuffe kann auf jedes SERTO-Formteil mit dem passenden zylindrischen Gewinde geschraubt werden und muss mit 1/4 Umdrehung angezogen werden.

Dichtungsprinzip: Bei der Montage drückt sich die Dichtkante des Übergangsstückes in das SERTO-Formteil ein, dadurch entsteht eine einwandfreie Dichtung.

Wir empfehlen, das Gewinde mit einem geeigneten Flüssigklebstoff gegen unbeabsichtigtes Lösen zu sichern.

Exemples d'utilisation:

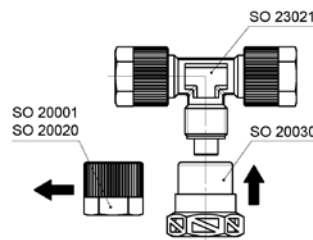


L'adaptateur femelle peut être vissé à toute pièce moulée SERTO avec le filetage cylindrique approprié et doit être serré de 1/4 de tour.

Principe d'étanchéité: Lors de l'assemblage, l'arête d'étanchéité de l'adaptateur appuie sur la pièce moulée SERTO, créant ainsi une étanchéité parfaite.

Nous recommandons de fixer le filetage avec une colle liquide appropriée pour empêcher le desserrage involontaire.

Sample combinations:

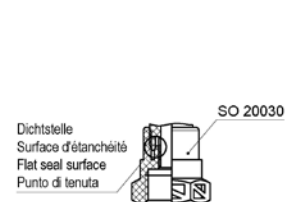

The female adaptor can be screwed onto all SERTO moulded parts with a matching cylindrical thread and must be tightened with 1/4 turn.

Sealing principle: During assembly, the sealing edge of the female adaptor presses into the SERTO moulded part to produce a perfect seal.

We recommend that the thread is secured against accidental unscrewing by means of a suitable liquid adhesive.